


SUBJECT: ALTERNATOR FR TERMINAL VOLTAGE — SERVICE MANUAL REVISION			No: TSB-05-13-006
			DATE: April, 2005
			MODEL: See below
CIRCULATE TO:	☐ GENERAL MANAGER	☐ PARTS MANAGER	☒ TECHNICIAN
☒ SERVICE ADVISOR	☒ SERVICE MANAGER	☐ WARRANTY PROCESSOR	☐ SALES MANAGER

PURPOSE

Beginning with the 1997 model year, the pull-up voltage of the alternator FR terminal was changed from 5V to **12V**.

Some MFI diagnosis procedures include checking the voltage at the alternator FR terminal. The correct voltage reading between the alternator FR terminal and ground should be **battery positive voltage (12V)**. This is incorrectly specified in Group 13 of the affected service manuals.

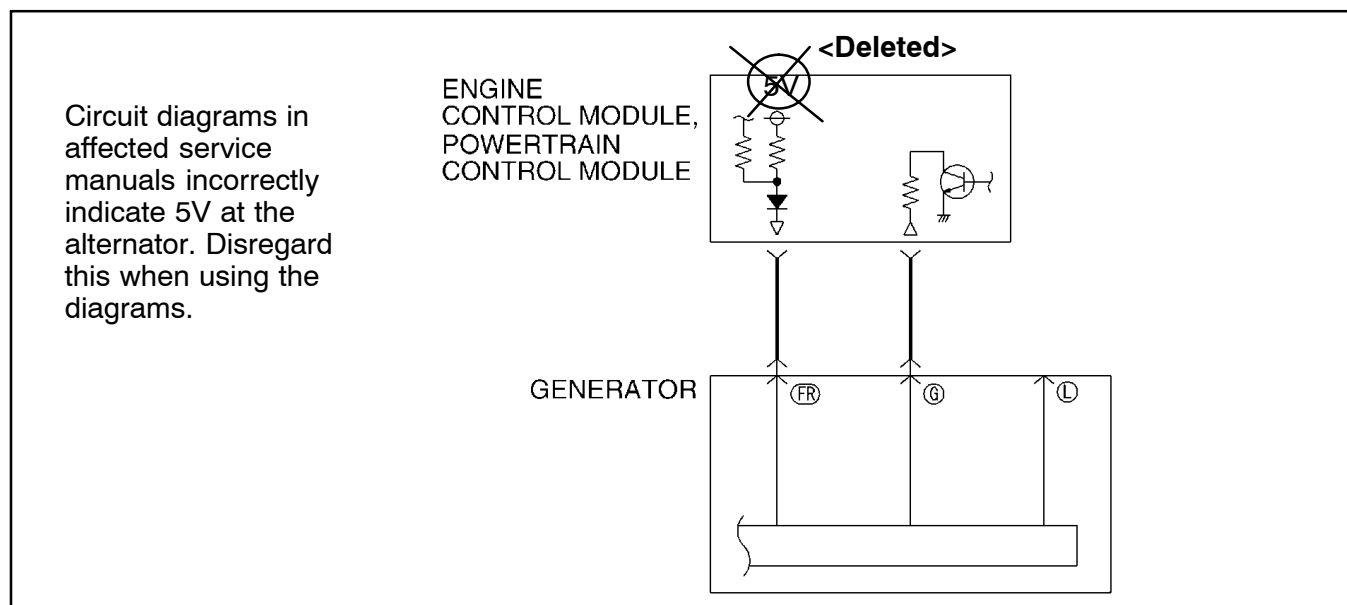

AFFECTED VEHICLES

1997-98 Mirage
 2002-05 Lancer
 2003-05 Lancer Evolution
 2003-05 Outlander
 1999-2005 Galant
 2001-2005 Eclipse/Eclipse Spyder
 2004-05 Endeavor

Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website (www.mitsubishitechinfo.com).

FILE UNDER:

Group 13 Fuel in the Dealer Service Information Binder

(2865)